



Technical Service Bulletin

AUTOMOTIVE <> PASSENGER CAR ACCESSORY BELT DRIVE SYSTEM

BULLETIN PA010-12

> **PART NUMBER:**

38332

> **MAKE:**

Honda

> **MODEL:**


Accord
Odyssey
Pilot
Ridgeline

> **YEAR:**

2003-2007

> **ENGINE:**

3.0L
3.5L

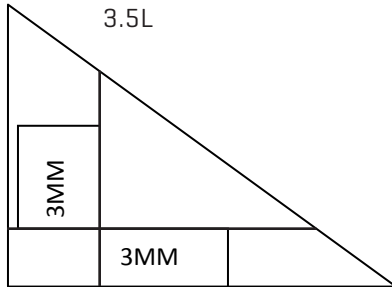

GATES CORPORATION <> WORLD HEADQUARTERS

1551 Wewatta Street / P.O. Box 5887
Denver, Colorado 80202, U.S.A.
303.744.1911
Gates.com

GATES CANADA INC.

225 Henry St. Bldg. 8
Brantford, Ontario N3S 7R4
1.519.759.4141

Automotive Tech Email <>
apateam@gates.com



For more information, please contact our Technical Department at 303.744.5651 or apateam@gates.com.

ACCESSORY BELT DRIVE SYSTEM

HONDA

Particular V-6 applications described in Honda Bulletin 08-082 may require a small modification to the front timing cover during replacement of the accessory drive belt tensioner. [Gates part number 38332] The OE now provides an updated tensioner assembly which may cause interference with the front timing cover of some applications. Gates also offers the same, updated design as the OES. The small task is to remove approximately 3mm of plastic material from the front cover, allowing proper clearance.

This area will need to have 3mm of material removed.



IMPROPER INSTALLATION MAY RESULT IN A DAMAGED FRONT TIMING BELT COVER AND IMPROPER ACCESSORY BELT TRACKING, EVENTUALLY LEADING TO BELT FAILURE!

**With over 100 years of experience,
Gates products are trusted by professional
technicians around the world.**