



Chrysler Voyager II (GS) Model year : 1995–2001 Engine : 3.3 i

Automatic transmission does not change gear / speedometer not working

If, in the case of the above-mentioned vehicles, the automatic transmission no longer “changes up” in the gears D, 3 and L and if at the same time the speedometer fails, this may be connected with the failure of a speed sensor (Fig. 1). Before replacing the speed sensor, which is located at the front of the transmission (above the oil pan) (Fig. 2), it is recommended that the wiring and the plug-connection be checked. The sensor can best be reached from underneath. To make access easier, the cable loom which runs past this area should be pushed to the side, after removing the fastening straps. The new sensor must be tightened to a torque of 7 Nm. The cable loom must then be put back in its old position and refastened.



Fig. 1



Fig. 2