



Citroen C4 All left-hand drive models Model years to 06/2008

ESP/ABS pilot lamp lights up

If a customer complains about the above error, this could be caused by the brake pedal position sensor. Various problems may also occur with cruise control, such as:

- Intermittent or complete failure of the vehicle-speed limiter.
- Intermittent or complete failure of cruise control.
- Cruise control switches on by itself.

The stop lights may also fail. In such cases, the old position sensor must be replaced with a modified version. An adapter lead must also be installed. During installation, ensure that no areas of the lead will become worn.