



Citroen C5 2.0 L Up to model year 15.09.01

Engine will not start

If there are complaints about the above-mentioned fault, the cause may be a blown fuse. In the case of the above-mentioned vehicles, which are equipped with a Siemens Sirius 81 injection system, fuse F 2 (fuse box in the engine bay) can blow. This overload arises due to a sticking fuel pump in the tank. In this case, the pump must be replaced.

Bulletin

