



Citroen Xsara Picasso With engine 1.6i (engine code NFZ) 2.0HDI (engine code RHY)

Engine occasionally cannot be started.

If there are complaints with these vehicles that the engine occasionally cannot be started, one possible cause is moisture in the plug of the engine control unit. Water ingress gives rise to oxidation and therefore to contact problems on the connection pins. In order to eliminate the fault, the oxidized pins and plug-contacts must be cleaned. In order to avoid renewed water ingress, an additional cover must be installed. This cover can be obtained via the Citroen organization.

Bulletin

