



Citroën XM (3Y)

Coolant warning light comes on

In the above-mentioned vehicles, a frayed cable on the brake pad wear indicator can lead to the coolant temperature display or coolant level display lighting up. This is caused by the fact that the warning contact on the brake pad wear indicator and the coolant warning lights share a ground connection.

In the case of complaints, the brake pad wear indicator wiring should be checked, particularly near the brake calliper, and repaired or replaced if necessary.

If the coolant level warning light should light up suddenly although sufficient coolant is in the recovery bottle, corroded sensor tips or plug contacts on the filling level sensor must be considered as a potential cause.

Bulletin