



Daewoo Matiz (KLYA) Model year: 1998 - 2000

Poor throttle response / Engine stalls

With the above-mentioned vehicles, an incorrectly routed high-voltage ignition cable can lead to the engine stalling or to poor throttle response.

Sometimes in the course of servicing work, the high-voltage ignition cable can be connected up in such a way that it comes in contact with the steering roller of the throttle control cable. This can impair the function of the throttle control cable and/or damage the high-voltage cable. If there are such complaints, the ignition cable should be checked for damage and replaced if necessary. The cable must be routed and fixed in such a way that contact with the steering roller is ruled out.