Bulletin



© Hella KGaA Hueck & Co., Lippstadt

15 May 2007

2007 1-2

Fiat Ducato Model year 04.2002 to 08.2006 All vehicles with automatic transmission Vehicle identification nos.: 7000007, 7000039, 7002182, 7003206, 7003237, 7006227, 7006888, 7009660, 7009672 and 7011920 to 7341167

Problems with the automatic transmission/heavy gear selection

If there are complaints about the above-mentioned fault, the cause could be a corroded multi-plug. The entry of water can give rise to corrosion on the contacts of the multi-plug of the transmission control unit. In this case, proceed as follows:

- Remove the plug of the transmission control unit (see Fig. 1).
- Check the plug-type contacts for corrosion and clean them.
- Remove towards the rear the protective grommet of the plug (see Fig. 2).
- Using a suitable sealing agent (e.g. silicone), seal the rear surface of the plug (see Fig. 3).
- Allow the sealing compound to dry and cure.
- Refit removed parts in reverse order.





© Hella KGaA Hueck & Co., Lippstadt 15 May 2007 2-2

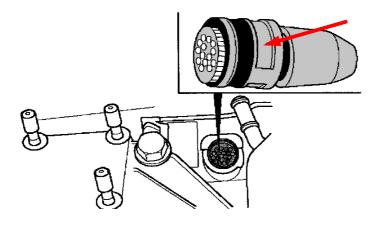


Fig: 1

 


Fig.: 2



Fig: 3

