



Fiat Idea 1.4L Model year from 2004 to 2006 Vehicle identification no. from 0005007 to 00065546 All automatic-transmission vehicles

Defective automatic transmission, stiff gear selection

If there are complaints about the above-mentioned fault, the cause could be a leaky multi-plug. Due to water ingress into the multi-plug of the transmission wiring harness, the above-mentioned fault occurs. In this case, proceed as follows:

- Remove the multi-plug of the transmission wiring harness.
- Pull back the rubber boot. Pull the rubber seals of the pins out of the plug and check the pins for corrosion. If necessary, clean the pins (see Fig. 1).
- Dry the plug and the pins.
- Properly press the rubber seals of the pins into the plug housing again.
- Fasten the rubber boot onto the plug housing again.
- Wrap insulating tape around the thinner end of the boot.
- After this, use a cable clip to secure the boot at the thinner end (see Fig. 2).
- Refasten the multi-plug and check the system for perfect operation.
- Use a cable clip to fasten the multi-plug, in order to avoid possible contact problems (vibrations) (see Fig. 3).

Bulletin

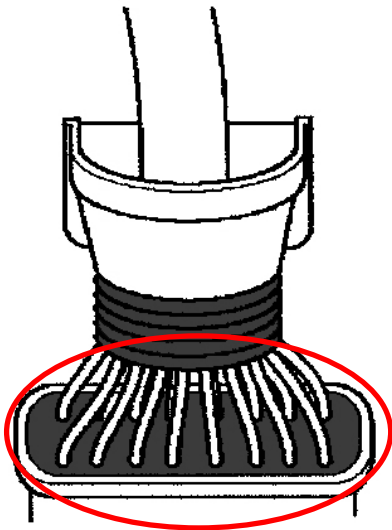


Fig. 1

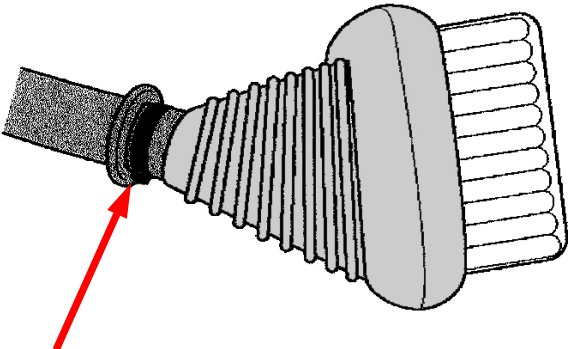


Fig. 2

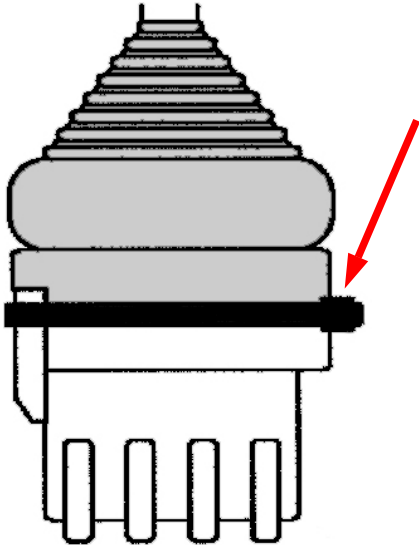


Fig. 3