



Fiat Punto ***All models from 05/2000 to 07/2000***

Temporary failure of the speed display

If there are complaints with these vehicles that the speedometer fails some of the time, one possible cause is an incorrect signal from the speed sensor. The engine control unit receives an incorrect signal due to the faulty speed sensor, which in turn leads to the failure of the speedometer. To eliminate the fault a new modified speed sensor has to be installed. The speed sensor is installed in the gear. The modified sensor can be recognised by the green marking on the plug and the manufacturing number 07F0 on the sensor housing.

Bulletin

