



Fiat Punto Model year from 1999 to 2001 All vehicles with electrical power assisted steering (City function)

The warning light of the electrical power assisted steering lights up

If there are complaints about the above-mentioned fault, a poor plug-type connection could be the cause. Poor contacting at the blue 2-pin (1) and black 10-pin (2) connector leads to repeated interruptions, but a fault is not stored. The connectors are beneath the steering column (see fig.). In this case the connectors have to be "reworked" in such a way that secure contacting is guaranteed. To do this separate the plug-type connection and press the individual cable lugs together with the aid of a small screwdriver in such a way that higher contact pressure is achieved on the individual pins. Reinsert the connector and check the correct function of the power assisted steering.

