



BULLETIN

Ford

Model: B-Max 1.6 8V TDI

Model year: from 2012 onwards

All models with ABS/ESP

ABS warning light illuminates

Error code: C1288

Pressure switch – faulty circuit

If the above error is discovered together with an illuminated ABS warning light, this may be due to the brake pressure sensor.

A signal evaluation error results in an error being entered in the control unit.

As it is not possible to take measurements on the sensor itself, first of all check the power supply and the peripheral equipment of the ABS system in this case.

If all measured values correspond to the setpoints, the pressure sensor must be replaced.

Repair note

The pressure sensor is integrated in the ABS hydraulic unit. In the case of damage, the entire ABS hydraulic unit must be replaced.