



Jaguar X-type from model year 2001

Sporadic failure of the radio remote-controlled central locking system

The above fault is an indication of a fault in the central locking control unit (CL control unit).

Note: In this case, a jammed dust protection cap (see illustration) can also lead to failure of the central locking control signal.

Conclusion: If the central locking system only functions mechanically (through door lock), the dust protection cap could be jammed or not return to its initial position after the ignition key has been removed due to poor spring loading. This leads to the central locking system failing to react to the radio signal from the manual transmitter.

Remedy: Use a suitable lubricant to get the dust protection cap working again. If this is not possible, the ignition lock must be replaced.

