



Jeep Grand Cherokee Model year: 1999 + 2000

Cold air in the footwell / strong wind / engine noises

In vehicles made in the above-mentioned model years, cold air can escape permanently in the footwell when the air conditioning system is switched on. In addition there can be strong wind / engine noises inside the vehicle.

One possible cause can be a missing seal between the heating/evaporator housing and flame protection block. To eliminate the problem please proceed as follows:

- Remove the windscreen wiper and water box cover
- Remove the cover grid from the air intake (heating/air conditioning)
- Put your hand into the air intake opening and check the foam seal which should run all the way round.
- Correct wrongly positioned seal areas.
- Repair faulty seal areas with suitable sealing material.
- In extreme cases it can be necessary to remove the heating/evaporator unit and reseal the whole system.

Installation is in reverse order.

Bulletin