



Kia Sephia ***Model year 1995 - 1998***

Noise / Leaks

With some of the above-mentioned vehicles, noise can occur from the area of the evaporator. Vehicles built between 1995 and 01.07.1998 are particularly affected. The cause is usually to be found in the expansion valve. This was modified in vehicles built since July 1998 and should be replaced in the event of a complaint.

If there should be a loss of refrigerant in these vehicles due to leaks, the lines and their connections must be inspected particularly carefully. The suction line was modified by the factor from mid-1997 due to various problems. The new line is now attached at the top of the compressor and is of a more simple design. The fastening bow is no longer required.

Bulletin