Bulletin



| © Behr Hella Service GmbH, Schwäbisch Hall | 01. Oktober 2005 | 1-1 | |
|--|------------------|-----|--|
|--|------------------|-----|--|

Lexus RX300 Model year: 1998 – 1999

Rattling noises

If rattling noises from the engine compartment should be heard inside the passenger compartment, this could be caused by refrigerant lines lying on top of one another. The noises can be heard particularly clearly when the compressor is switched off. To remedy the problem, check the refrigerant lines in the engine compartment (area circled in the drawing). If the lines are too close together, the area should be insulated or sheathed using appropriate material, such as sponge tape, Hella part no. 9MJ 351 018-011.





