



Mazda

3 (BK12, BK14)

Model year: 2003–2006

Air-conditioning system not working

In the case of the above-mentioned vehicles, a faulty harness can result in the air-conditioning system no longer switching on. The wiring harness, which leads to the pressure switch, may be too short. With each movement of the engine block, the wiring harness is under tension, which can cause the wiring to the pressure switch to break. It is difficult to repair the wiring harness at this point. For this reason, Mazda offers a special repair harness with plug.

Bulletin