



## **Mercedes Benz E-Class (W210) All engines**

### **Air conditioning system occasionally does not work**

If there are complaints about the above-mentioned fault, the cause could be a defective pressure switch. Under certain circumstances (temperature-related), the pressure switch sends incorrect pressure values to the control unit/panel. In these cases, the compressor is not triggered.

For diagnosis, proceed as follows:

- Connect a diagnosis tester to the vehicle.
- Select the menu "Measured values/Parameters".
- Take a readout of the "actual value" from the pressure switch.
- Connect a pressure gauge to the service connection (high-pressure side).
- If the pressure difference is greater than 2 bar, the pressure switch on the dryer must be replaced (Behr-Hella no.: 6ZI 351 028-161).

**Bulletin**