



Mercedes Benz A-Class Type W 168

The ESP warning light comes on and fault code C1142 is stored.

If there are complaints with these vehicles that the ESP warning light comes on and the fault code C1142 is stored, one possible cause can be the control unit. In this case the transverse acceleration sensor is being monitored too sensitively by the control unit and the above-mentioned faults occur. To eliminate the problem the ESP system has to be checked for faults. If no faults can be found, the ESP control unit has to be replaced. Replacing the transverse acceleration sensor is not the remedy.

Vehicles and control units affected:

A-Class W 168 Type 168.007 / 008 / 031 / 033

Chassis no.: J to 247148

Control units with part no. : 027 545 60 32
028 545 26 32