



## ***Mercedes Benz C-Class (W202) With 220 CDI (611.960) engine***

### **Engine dies when driving.**

If there are complaints with these vehicles that the engine dies after a drive of approximately 70 km, one possible cause is a leaky fuel-filter housing. The leak in the housing is so small that no fuel escapes, but only air enters the system. It may be that fault code P1187 "rail-pressure monitoring" is stored in the fault memory. In order to eliminate the fault, the fuel-filter housing must be replaced with a modified version.

**Bulletin**

