



Mercedes Benz C-Class (W202)

Airbag (SRS) light permanently on

If there are complaints about the above-mentioned fault, the cause could be a loose plug connection. If cables have not been laid correctly, the plug connections (D) on the contact strip on the left or right under the seat (Fig. 1) can become loose from the contact strip when the position of the seats is adjusted. In this case, the cables must be re-laid. In addition, the fault codes 5 or 6 could be stored.

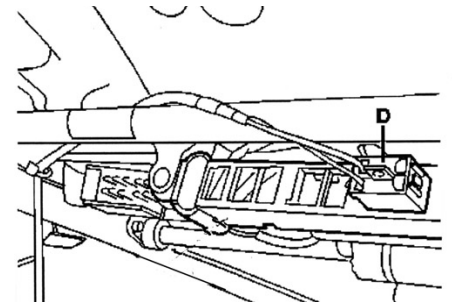


Fig. 1

Procedure:

- Pull the cable plugs off the contact strips.
- Measure the length of the cables from the plugs to where they enter the carpet
- Correct the cable lengths if necessary (Fig. 2)
- After checking or correcting the cables, fix them in the cable shaft again using cable ties
- Delete the fault memory

300 mm :
Cable for electric seat
adjustment

360 mm:
Cable to seatbelt
lock

380 mm:
Cable to seat heating

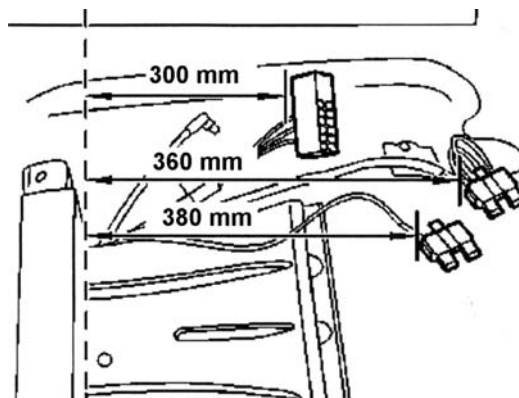


Fig. 2