



## Mercedes Benz M-Class

### Faulty function, central air vent and fault code B1202

If there are complaints about the above-mentioned problem, the reason could be a faulty setting motor sleeve. With this vehicle, the stop from the setting motor sleeve (central air vent in the dashboard) occasionally breaks off. In this case a new sleeve has to be installed.

Proceed as follows:

- Remove the instrument cluster.
- Loosen the screws (1).
- Remove the setting motor of the central vent (2) on the air channel.
- Remove the sleeve(3) from the air channel and insert a new sleeve.
- Replace the setting motor.
- Reset the setting motor to the zero position with the aid of a diagnosis tester.
- Replace the components in reverse order.
- Delete the fault store.
- Check the system for correct function.

