




## **Mercedes Benz M-Class (W163) Type 163. ... .A from 145273 Type 163. ... .X from 708319**

### **SRS warning light comes on**

If there are complaints about the above-mentioned problem, a faulty contact on the side airbag could be the case. Faulty plug locking on the airbag unit (see figure) leads to this problem. In addition, the following fault codes could have been stored:

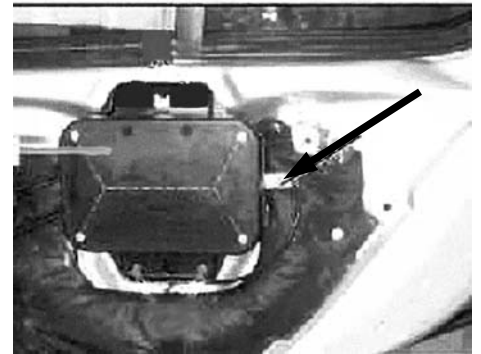

- B 1867 (squib, airbag front left).
- B 1869 (squib, airbag rear left).
- B 1871 (squib, airbag front right).
- B 1873 (squib, airbag rear right).

In this case proceed as follows:

- Delete fault codes using the diagnosis tester.
- Remove side panelling.
- Select the menu "measuring values/parameters" in the diagnosis tester.
- Select the sub-menu airbag/ignition circuit.
- Shake the plug connection and watch the values. If the values change, the plug connection has to be replaced.