



Mercedes S-Class (W140 + C140) Model year: 1991 to 31.07.1994 With automatic air conditioning With rear air-conditioning system

Compressor failure

In the case of the above-mentioned vehicles, the compressor may fail occasionally or completely. One possible cause is a break on the electrical plug-connection on the compressor. As the design of electrical harness is too short and is, under certain circumstances, under tension, the cables may become detached from the contacts. For this reason, within the framework of complaints concerning the air-conditioning system and/or when troubleshooting, particular attention should be paid to the plug-connection. It may be necessary to resolder the cable connections and/or to lengthen the cables. This fault should not arise anymore in the case of vehicles made from August 1994. Since then, the electrical harness was extended by the vehicle manufacturer by 50 mm.

Bulletin