



Mercedes

Unimog Type 427 (U1000, 1200, 1400...)

Type 437 (U1350, 1450, 1550...)

Model year: from 1988

Heating / Ventilation system: Failure of the blower motor

In the case of the above-mentioned vehicles, the interior blower motor may fail prematurely. Vehicles up to model year November 1995 are affected by this. These vehicles did not yet have a guard ring covering the area of the carbon brushes. When fitting a new motor, the guard ring, which can be obtained via an authorized dealer, must be retrofitted. Furthermore, a 4 mm hole must be drilled at the lowest point of the housing (below the connector plug), in order to ensure that water can drain.

In the case of vehicles from vehicle identification no.:

.... 184 558 (model year: approx. November 1995), the guard ring was pre-fitted at the factory and can be reused when replacing the blower motor.

Bulletin