



Mercedes V-Class (638/2) Running gear no.: up to 206854 Engine: 200/220 CDI (638.294) With digital heater regulation

Inaccurate heater regulation

With the above-mentioned vehicles with digital heater regulation, inaccurate heater regulation can occur. The regulation can be impaired by heat radiation from components located near the interior temperature sensor. To remedy the problem, the heater operating unit can be replaced by different one with modified software. Proceed as follows when replacing the unit:

- Remove the cover in the centre of the instrument panel
- Loosen the attachment screws (4x) on the operating unit
- Unhook the Bowden cables, checking they run smoothly
- Pull the electrical connectors off
- Installation is in reverse order. Make sure the flaps close and open completely

Bulletin