## **Bulletin**



© Behr Hella Service GmbH, Schwäbisch Hall 12. January 2009 1-1

## Mercedes W124 (E-Class) Model year: 1989 to 1995 With semi-automatic air conditioning

## Interior blower not working

If the interior blower should fail in the above-mentioned vehicles, this can be due to a contact fault in the fuse box. If the temperature at the fuse slot for the interior blower is too high, the fuse support can be lowered. This means a perfect electrical contact is no longer guaranteed. To prevent the whole fuse box from having to be replaced, a separate fuse carrier (photo) can be installed outside the fuse box. The electrical cable to the interior blower must be routed to the outside accordingly and connected to the additional fuse carrier (e.g. from the Hella electrics range).



## Bulletin

