



Mitsubishi Galant **All models from 1999 – 05.2001**

Noise from the rear wheel bearings.

If there are complaints with these vehicles that the rear wheel bearings are making a noise, one possible cause is water penetration. A leak between the wheel speed sensors and the stub axle allows water to penetrate the wheel bearing and cause damage.

To eliminate the fault the wheel bearings have to be checked and replaced if necessary. At the same time, a sealing agent should be applied to the contact surface of the wheel speed sensor to prevent renewed humidity penetration.

From 05.2001 onwards, modified stub axles with an O-ring were installed in the vehicles. If it is necessary to replace the wheel speed sensor with these models, the O-ring should always be replaced at the same time as well.

Bulletin