



## ***Mitsubishi Pajero*** ***All models with automatic*** ***transmission built between 2001 and*** ***2002***

### **The 4-wheel drive warning light comes on, fault code 033 stored**

If there are complaints about the above-mentioned fault with these vehicles, the problem could be caused by the detection switches on the gearbox. These switches determine the switching state of the gears. Water penetrating the electrical connections leads to corrosion and the problem described above. To eliminate the fault, check the electrical connections and clean them if possible. If the connections are corroded to an extent that this is no longer possible, modified gear detection switches must be installed.

Cleaned plug connections should be protected from further water penetration.

**Bulletin**