



## **Nissan**

### **Pathfinder, models 1996 – 2001**

### **Maxima (A32), up to model year 1999**

### **Maxima (A33), up to model year 2001**

#### **Noise from blower motor**

In these vehicles, noise may occur which is caused by the passenger compartment blower motor. The noise is best heard in the first and second blower stage. The noises vary between rattle/clatter and ticking/buzzing. Rattling and clattering noise is mostly caused by pollution in the blower housing. To eliminate the fault, the blower motor should be removed and the blower housing be cleaned. Ticking and buzzing noise is mostly caused by the blower cover. The cover should be replaced by a modified cover which can be bought from the vehicle manufacturer. To do this, the blower motor needs not be removed. Prior to mounting the cover, clean the outer side of the blower motor and pull the plug. Then remove the protective cover of the adhesive tape on the inside of the cover. After assembly, reinstall the plug on the blower motor and make a "sound check" at low blower speed.

Bulletin