

Opel

Astra G / Astra H

Model year: 1998 - 2009

With manual, semi-automatic and fully automatic air-conditioning system

Recirculated air flap is not working

With the above-mentioned vehicles, a damaged shaft can lead to a malfunction of the recirculated air flap.

To remedy the situation, a modified recirculated air flap housing has to be installed. To do this, remove the short shaft in the recirculation flap motor and mount the long shaft included with the modified housing (see drawing). After conversion, a basic setting or functional test should be carried out.


Modified housing with end stops were used in product from the following VIN onwards:

WOLOAHL699G013486 (Gliwice plant)

WOLOAHL4895015120 (Antwerpen plant)

WOLOAHL4898019565 (Ellesmere Port plant)

WOLOAHL3592020114 (Bochum plant)

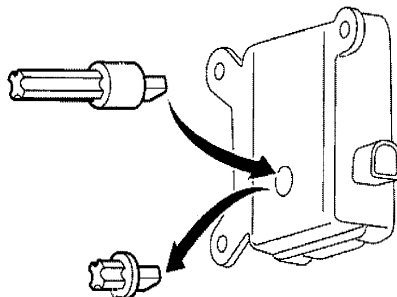

Bulletin