



## **Opel**

### **Astra-G, Zafira**

### **With engine: Z16XE + Z18XE**

#### **Noises/Vibration**

If there are complaints with the above-mentioned vehicles (noises/vibration), the refrigerant pipes should be checked to make sure that they are laid correctly.

Contact with the vehicle body for example can cause noises/vibrations to be transmitted to the vehicle interior. If the check of the refrigerant pipes reveals no cause for complaint whatsoever, a remedy may be found by reducing the refrigerant level (from 600 to 525 grams).

In relation to this, please refer also to the Technical Information sheet "Noises".

**Bulletin**