



Opel Corsa B, Tigra, Astra F, Vectra B With engine: X14XE, X16XE, X16XEL

Noises / vibrations

If, in the case of the above-mentioned vehicles, noises/vibrations occur in the area of the engine bay, the cause may be a defective coolant pump. Corrosion arises due to water ingress into the bearings of the coolant pump. This results in damage to the bearings, causing varying levels of noise and possibly also vibrations. In case of complaint, the coolant pump should be checked and, if necessary, replaced. From the following engine numbers onward, improved coolant pumps were used by the vehicle manufacturer as standard:

02 GD 1304 or 20010578



Bulletin