



Opel Corsa C **From model year 2001 with engine** **Z10XE, Z10XEP, Z12XE, Z14XEP**

Water loss, engine overheated

If these vehicles lose water, resulting in overheating of the engine, one possible cause is a worn water hose. The hose affected is the one from the water pump to the radiator expansion tank. A jamming pressure relief valve in the lid of the expansion tank causes the hose to constrict and slip out of the bracket of the fan housing. The hose then gets caught by the fan and wears through.

To eliminate the problem, the faulty water hose must be replaced and the pressure relief valve must be checked.

Note:

The correct fit of the water hose and perfect function of the pressure relief valve should be checked on these vehicles during a visit to the garage.

Bulletin

