



## **Opel Frontera B Model year 1999-2001 Engine: X22DTH/Y22DTH**

### **Loss of refrigerant**

Too little distance between the bracket for the front trim and the refrigerant line from the dryer to the condenser can lead to the line fraying. Damage occurs in the area between the condenser and the dryer. This can lead to a loss of refrigerant. In the case of damage, replace the refrigerant line by one of a modified design. The dryer must also be replaced.

After the repairs the air conditioning system must be checked for leaks. The refrigerant filling quantity is 650 grams.

**Bulletin**