



Opel Omega-B

Model year: 1994+1995

With automatic climate control

Blower motor cannot be switched off

If, in the case of the above vehicles, the interior blower motor can no longer be switched off, or if it continues to run after the ignition has been switched off, the cause may be a defective blower regulator. In particular, regulators with the marking BZ/9525 to BZ/9538 are affected by this. From calendar week 39/95 modified regulators were installed. These are marked with a black dot. To replace the regulator, proceed as follows:

- Switch off the ignition
- Remove the footwell trim panel on the passenger side
- Remove the glovebox
- Remove the connector from the blower regulator
- Remove the regulator

Installation of the new regulator takes place in the reverse order.

Bulletin