



Opel Omega B Up to model year 1998 Engines: X25XE + X30XE

Refrigerant loss / vacuum in main brake cylinder

In the case of the above-mentioned vehicles, a faulty retaining clip between the refrigerant hose and the vacuum hose of the main brake cylinder can lead to damage to the refrigerant line and/or vacuum line of the main brake cylinder. If the clip is faulty, the lines can touch and rub against each other causing fraying, as a result refrigerant can escape or the vacuum drops on the main brake cylinder. With these vehicles (particularly RHD vehicles), the retaining clip should be checked and replaced if necessary. The lines should be checked for fraying and replaced if necessary. A modified clip was used for all vehicles from model year 1998 onwards.

Bulletin