



Opel Sintra From model year 1997

Wiper arm moves beyond the A-pillar.

If there are complaints with these vehicles that the right-hand wiper arm moves beyond the A-pillar at high speeds, this could be due to a rubber stop being missing. To eliminate the problem, a new rubber stop has to be installed. To do this proceed as follows:

- Mark the spot on the wiper arm 4.5 cm away from the pivot point of the right-hand wiper arm using adhesive tape or non-permanent ink (see photo).
- Switch on the ignition, activate the wiper switch. Switch the ignition off again when the wiper arm is in the vertical position.
- Mount the rubber stop aligned to the centre of the marking on the wiper arm (see drawing).

In addition, the attachment screw should be checked for a tight fit.

