Bulletin



© Hella KGaA Hueck & Co., Lippstadt 11. Februar 2005

Opel Vectra-B From model year 1996

Radiator fan cable rubs on the bracket below the battery.

If there are complaints of electrical problems (failure of the radiator fan) with these vehicles, one possible cause is a defective cable. The radiator fan cable can rub against a bracket in the area below the battery. It is possible for a connection to earth to be made at the point where the rubbing occurs.

To rectify the fault, damaged cables must be repaired, and the cable loom must be fixed to the bracket by means of a clip. Fuses which may have blown must also be replaced.

Note:

The radiator fan cable should be checked during servicing / garage work and should, if necessary, be fixed by means of a clip before damage occurs.

