



OPEL

Vectra C

With automatic air conditioning

Misleading fault codes

If misleading/unknown fault codes should be outputted when the fault memory is being read out, this can have been caused by the electrical connections of the operating/control unit belonging to the air-conditioning system having been disconnected incorrectly.

If the blue plug is removed with the ignition on, this leads to one or more of the following fault codes being stored:

B0176, B0181, B0225, B0240, B0250, B0512, B0517

The fault codes are either unknown or connected with the voltage of interior sensors and actuator motors allegedly being too high/too low.

It does not necessarily mean that there is actually a fault. The problem can have been caused by the plug having been removed incorrectly in connection with repairs. In this case, the fault codes should be deleted and a functional check should be carried out.

Repeated read-out of the fault code will then provide information about any real fault that has occurred.

When removing the operating/control unit, make sure that the ignition remains switched off.