



Opel Vectra C Engine: all

Poor performance of the air- conditioning system / Very frequent compressor noises

With the above-mentioned vehicles with VIN:
WOLOZCF6921070460 to WOLOZCF6921082755, an
insufficient air-conditioning cooling performance can occur. At
the same time, very frequent compressor noises can occur.
This is often caused by too little refrigerant being filled into
the system at the manufacturer's plant. If there are any
complaints, determine the refrigerant filling quantity first, refill
the system following a leak test and check again.

Bulletin