



Opel Vivaro **Model year from 2001 to 2004**

Faulty body control unit

The above-mentioned fault can become noticeable on account of the following symptoms, among others:

- Rear window heating and heated outside mirror cannot be switched off, i.e. the battery is discharged.
- Immobilizer warning lamp does not go out and the vehicle does not start up. The battery has to be disconnected and reconnected. After this, it is possible to start up the vehicle again.

Constant operation of the rear window heating and the outside mirrors can lead to damage to the engine-control relay K18 and the relay of the heated rear window K3. For this reason, in the event of complaints, these relays should always be checked and, if necessary, replaced.

Generally speaking, all components that communicate with the body control unit can have malfunctions. In this case, a new control unit must be installed. On the control unit there is a white sticker with the supplier part number.

	Old part number	New part number	Opel no.
N1	91 168 139	93 853 271	44 15 608
N2	91 168 140	93 853 272	44 15 609
N3	91 168 141	93 853 273	44 15 610

N1 = Vehicles without central locking

N2 = Vehicles with central locking

N3 = Vehicles with central locking and alarm control system.