Bulletin



© Hella KGaA Hueck & Co., Lippstadt 12th June 2006 1-1

Opel Zafira A All models from model year 1999

Faulty window winder control

If there are complaints about the above-mentioned fault, corrosion could be the cause. The window windows open independently or can neither be opened or closed. Water penetration leads to corrosion forming in the plug connections of the door harnesses. The plug contacts must be cleaned and lubricated with contact grease. If the contacts are already heavily corroded, the harness affected must be replaced. The electric window winders and body harness definitely do not need replacing, however.



