



***Opel
Zafira B , CDTI
Engine: Z19 DTH
Model year: from 2005
All models with Electronic Stability
Program (ESP)***

Steering angle sensor cannot be calibrated.

If the steering angle sensor cannot be calibrated with the diagnostics device in the above vehicle, the following procedure may be successful.

- Disconnect the battery.
- Wait for 5 minutes.
- Remove the steering wheel.
- Align the steering angle sensor (centre position).
- Install the steering wheel.
- Connect the battery.

Then the calibrate using the diagnostics device.

Follow also the installation and removal instructions and the safety regulations when handling airbag systems of the vehicle manufacturer.