



## **Peugeot 206**

**with engine: 1.1i, 1.4i, 1.6i, 2.0i, 1.9D,  
2.0HDI**

### **Failure of electrical systems, smoke from the instrument cluster.**

If there are complaints with these vehicles that different electrical systems have failed and that smoke build-up arises from the instrument cluster, one possible cause is a defective earth cable. In this case, the earth cable from the battery to the transmission is affected. Here, cable breakage occurs directly on the cable lug on the transmission side. In order to eliminate the fault, the earth cable must be repaired and laid in such that it is not under tension. Blown fuses must be replaced. If smoke build-up has occurred from the instrument cluster, this must be replaced also.

**Bulletin**

