



Peugeot

307

Year of manufacture: to 13/05/2005

3- and 5-door without park pilot

Left parking light / tail light and licence plate light fail (fuse blown)

In the above vehicles, the wiring harness may be damaged in the area between the bumper and the bumper bracket. In addition, the F22 fuse in the fuse box / relay plate of the instrument panel may have blown.

This can cause the parking light, tail light and licence plate light to fail.

An over-long harness of the right licence plate light is a possible cause.

In this case, proceed as follows:

- Expose the licence plate light cables
- Repair the damaged cables.
- Roll up the cable of the right licence plate light to bring it to the same length as the cable of the left licence plate light.
- Wind insulating tape around both cables.