

© Behr Hella Service GmbH, Schwäbisch Hall

11 September 2007

Peugeot 407 Model year: 10.2004–04.2005 All models

Engine does not start / Coolant sensor

If, in the case of the above-mentioned vehicles, the engine no longer starts, the cause may be a porous coolant level sensor. Coolant can get into the engine harness through the sensor and prevent the engine from starting. In connection with engine running complaints, please pay special attention to the harness. If coolant has penetrated the harness, the harness has to be dried. All plug-contacts and connections have to be checked for moisture and corrosion. In this case, the coolant level sensor must be replaced.

The vehicle manufacturer informed all vehicle owners affected and asked them to have their vehicles checked at an authorized garage. It has to be assumed that vehicles that have not been checked or modified for various reasons are still in circulation. Bulletin





1-1