


Range Rover III (LM) Model year: 2002–2004

Poor cooling performance / Loss of refrigerant

If poor cooling performance or a loss of refrigerant is found in the case of the above-mentioned vehicles, one possible cause is a leaky condenser. A so-called condenser-dryer module is used in the case of these vehicles. This means that the dryer is located directly on the condenser. In this case, the dryer cartridge (Item **A** on the drawing) can be replaced separately. Sometimes, a white substance can be seen in the area of the threaded cap, the holder for the dryer cartridge. This is attributable to residues from the soldering process. As a result of this, there is a risk of the threaded cap not sealing sufficiently and of corrosion arising. In the event of leaks, usually only the replacement of the entire condenser helps. Condensers and dryer cartridges for this vehicle can be found in the *Behr Hella Service* spare-parts range.

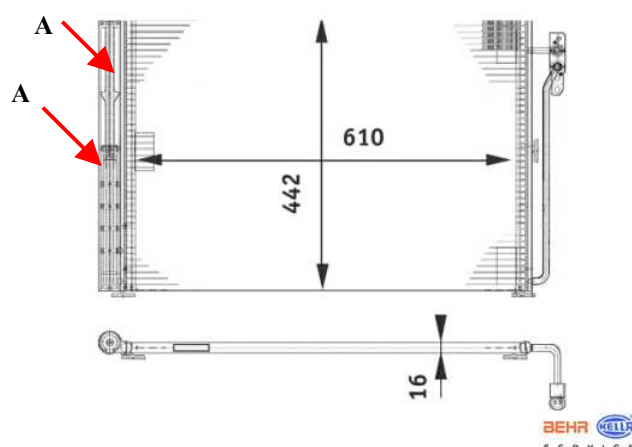

Bulletin