## Bulletin



© Behr Hella Service GmbH, Schwäbisch Hall 01. Oktober 2005

## Renault Clio 2 Model year: 2001-2002 With engine: K9K (1.5 dCi)

## Compressor without function / vehicle doesn't start up

If there are complaints with the above-mentioned vehicles about the compressor not switching on and/or the engine not starting up, this can be related to the compressor wiring. The power cable can become damaged due to permanent contact with the low-pressure line of the compressor. To remedy the problem, the cable must be checked for damage, repaired if necessary and fixed in place again using a cable tie. Vehicles where this measure has already been carried out are marked by a blue sticker on the spring dome with the "B6" field marked.



