



Renault Laguna I with A/C

Failure of the A/C

The vehicle concerned is the B56X, the X is for the different types of the Laguna. The next letter behind the X in the registration document identifies the exact model variant.

The engines concerned are: F3P 670/678; F3P 720/724; F3R 722/723.

If the above mentioned failure is queried, the cause could be a deformation of the compressor head. Through this deformation the flange mounting (high-and low pressure connection) at the compressor is also damaged and refrigerant escapes between the flange mounting and the compressor. In this case the compressor, dryer and the flange must be replaced.

Replacement parts:

Compressor	3 FK 351 126 -141
Dryer	8 FT 351 195 - 551

The flange with the high- and low pressure tube must be ordered from the manufacturer.

Bulletin